


4.0 Addendum – reinstatement of complete sundial.



Sundial-parapet as existing (top quarter of sundial missing)




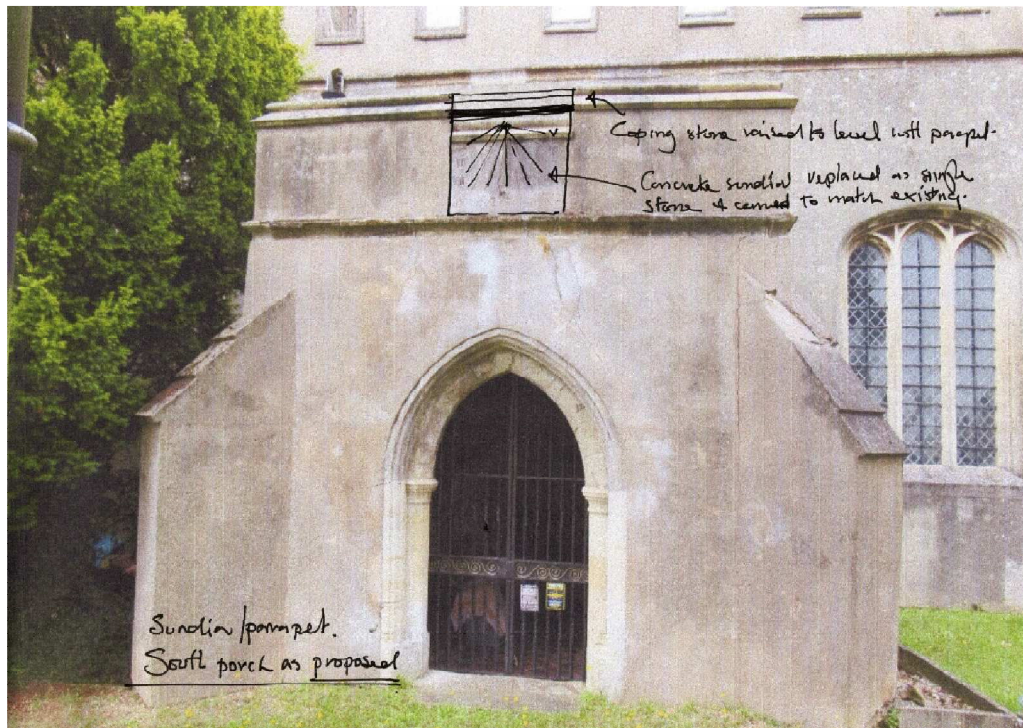

Sundial – parapet as proposed

- 4.1 Carefully remove coping stone from over sundial and set aside.
- 4.2 Record the detail on the face of the concrete sundial and remove it.
- 4.3 Repair backing brickwork and raise up in sound well burnt stock bricks level with the walls on either side. Tie into side walls with ss mesh or ss brick ties.
- 4.4 Supply and fix new sundial as single slab of Stoke Ground base bed, 50mm thick and secure to new and existing brick backing with ss dowels and a backing bedding of lime mortar.

New sundial to match existing detail and to include the missing detail as shown in sketch and photograph.

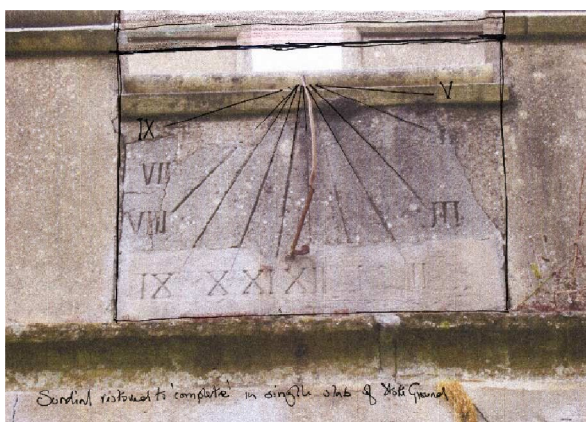

Sundial as proposed -



- and as it used to be 1994

- 4.5 Replace and seat existing coping stone to be level with coping stones on either side.

St. Marys Cathedral - the inside part - B&D's. N.T.S.

